



IP Office Technical Tip

Tip Number: 262

Release Date: 18 February 2014

Region: GLOBAL

IP500 Digital Station Modules (DS16B / DS30B) – Critical Patch Availability for 8.1 Software

Further to the announcement in IP Office Technical Tip 261, this Technical Tip is to advise customers about the availability of a Critical Patch (CP) to enable support for the IP Office Digital Station Modules (DS16B / DS30B) with IP Office Release 8.1 software.

The CP, 8.1(798402), consists of new Control Unit binary files for the IP500 / IP500V2, Manager components, and Expansion Module software for the DS16B / DS30B.

The software is available from the Avaya Support web site:

<http://support.avaya.com>

IP Office Administration 8.1(79) must be installed prior to applying the CP. The CP can then be applied using the following instructions:

- 1) Run the CP executable and extract it to a temporary folder.
- 2) Copy the Manager DLL files, Manager executable and “bin.cfg” files into the Manager installation folder overwriting the existing files.
- 3) Copy the “IP500.bin”, “IP500v2.bin” and “dsaupnV1.bin” file into the Manager installation folder overwriting the existing files.
- 4) Start IP Office Manager and upgrade the Control Unit.
- 5) When the Control Unit has upgraded and restarted it will then recognise DS16B and DS30B Expansion Modules
- 6) Restart the Upgrade Wizard and upgrade the DS16B / DS30B Expansion Module(s).

The CP will be incorporated into 8.1 Service Pack 9 available May 2014.

Issued by:
Avaya SMEC Customer Product Engineering Support

Contact details:-
EMEA/APAC

Email: gsstier4@avaya.com

NA/CALA

Email: IPONACALAT4@Avaya.com

Internet: <http://www.avaya.com>
© 2014 Avaya Inc. All rights reserved.